

Jewelry - Rolling Mill

Durston Tools MINI C80

- [Manual\(s\)](#)
- [Tool Guide](#)

Manual(s)

[Rolling Mill Manual.pdf](#)

Tool Guide

This tool guide is incomplete; these sections were taken from the manual.

Safety

1. Always bolt down your rolling mill to a secure bench or secure stand for stability and safety. Also ensure that the bench or stand is securely fixed to the floor.
2. Ensure guards are in place at all time. The guards are the black plastic covers, covering the gears.
3. Do not lift the mill by the hand wheel, only lift from the base. Always make sure at least 2 people carry the mill.

Care

1. When the rolling mill is not in use, apply a thin coating of rust preventative liquid. Using a clean and dry paint brush (approximately 12mm wide) apply the rust preventative across the rolls. Turn the rolls as you do this. Make sure the rolls are nearly closed. This will spread the liquid evenly over the surface. It is very important that your rolls are always protected, especially in moist/wet/hot conditions or where temperatures are changing. Once your rolls are marked/rusty/corroded they will be like this until you have them removed and re-ground. (However, please note that it is almost impossible that you will end up with perfect rolls. Over time and use they will get slightly marked but will still work perfectly well). When using your mill again remove all rust preventative and ensure your rolls are clean and dry before you start to roll material. See "removing rust preventative" at the beginning of this manual.
2. It is also recommended that you cover your mill when not in use. This is to prevent the rust preventative from collecting dust and dirt.
3. Keep the rolls clean. Do not touch the rolls. Oils and acids from your body can damage the rolls, leaving behind small marks and eventually rust.
4. Make sure all material is dry before rolling.
5. Do not use your mill with the rolls completely closed.
6. Do not roll ferrous metals such as iron or steel through the mill.
7. Always release pressure on the rollers after you have completed your job.


Sheet Rolling

1. Anneal the piece of sheet or ingot, pickle it, and rinse it with clean water. Now dry it.
2. Feed the dry metal into the mill, applying snug (but not overpowering) pressure on rollers.

3. After rolling the metal through the mill, flip the piece end to end before you roll it through again. You will get a more even roll.
4. Before passing metal through the rollers, lower the rollers until you have a snug fit (as in step 2).
5. If the metal becomes hard to roll, it must be annealed again. Then roll the piece through the rollers, repeating as necessary until the desired thickness is achieved.
6. When rolling silver sheet, it may be necessary to anneal the sheet after rolling it from 3mm to 1mm thickness. For 14ct gold, the annealing may be necessary after rolling from 3mm to 2mm.

Wire Rolling

Reduce the wire by rolling 2 or 3 times in each groove rotating the wire 90 degrees on each pass. Rolls should be nearly closed for the last pass before moving to the next groove. Depending on the material, passes of up to 30% can be achieved. The material should be annealed as often as necessary to avoid excessive force when rolling. Indications of excess hardness are frayed edges, wrinkling of surface, surface cracking or excessive force needed to turn the rolls

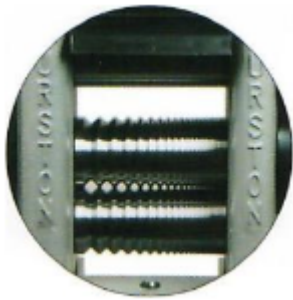

Special Technique - Rolling Mill Printing

The Rolling Mill

The rolling mill is a machine designed to produce thinner gauges of sheet metal and wire. Most studio jewellers use a hand cranked mill (although automated mills are used as well). Each mill consists of two smooth, highly polished hardened steel rolls, mounted in the housing parallel to each other. The rolling mill is used for reducing the thickness of sheet metal. The rolls for wire are cut with 'V' shaped grooves arranged in decreasing sizes, allowing for gradual reduction of wire diameter and producing a square cross section of wire. Most studio jewellers choose a 'combination' mill - half of the roll is smooth (for sheet metal) and half is grooved (for wire). This limits the width of the metal to be rolled (averaging about 50-60mm).

Introduction to Printing

Metal which is passed through the rolling mill under pressure with another material will become embossed with a pattern exactly the same as the material being used. Any small

particle trapped between the metal and roll will 'imprint' on the metal. If you are attempting to roll a perfectly smooth piece of metal, this is not desirable. But the principle can be put to use to create embossed patterns and designs on metal.

The best way to imprint metal is to create a 'metal sandwich' with two pieces of metal (to be impressed) on the outside (the 'bread' in the 'sandwich') and the material being used as pattern between them (the 'filling').

One-Sided vs. Two-Sided Imprinting

If you wish to imprint on one sheet of metal only, roll the metal together with the imprinting material, using the roll as the other

side of the 'sandwich'. This technique is preferable when using expensive materials (gold and sterling) but has its drawbacks, as

there is more possibility of damaging the rolling mills if materials that are too hard are used for imprinting. It is best to make a

'metal sandwich' whenever possible - it produces two pieces of usable, imprinted metal with mirror image imprints (especially

useful for earrings, being symmetrical, but reversed).

Process


Metal to be imprinted must be annealed, dry and clean. Depending on the use of the metal after being imprinted, you may wish an emery finish or Tripoli rouge polish. Usually the metal that is the pattern (the 'filling' in the sandwich) should not be annealed - if it is hard metal you will get a better imprint and may be reusable.

2. The pattern imprinted will be a reverse of the design (important to remember if using letters and numbers in the design).

3. An object placed between the two pieces of metal will create a recess in the metal (intaglio; a mechanical 'etching' effect). As the 'metal sandwich' passes between the rolls and is compressed, the imprinting material is pushed into the metal. Be careful not to roll the imprint so that the metal becomes too thin.

4. Make one pass only! Carefully adjust the gap by attempting to roll the first ½ inch (1cm) or so. Trial and error and experience, along with written notes, are all part of this process. Once the correct gap is calculated, roll the whole piece in one continuous roll. Try not to stop part way through the pass.

5. To emboss: use a plate with negative spaces so that when rolled the metal plates push into the recessed shapes on the pattern.

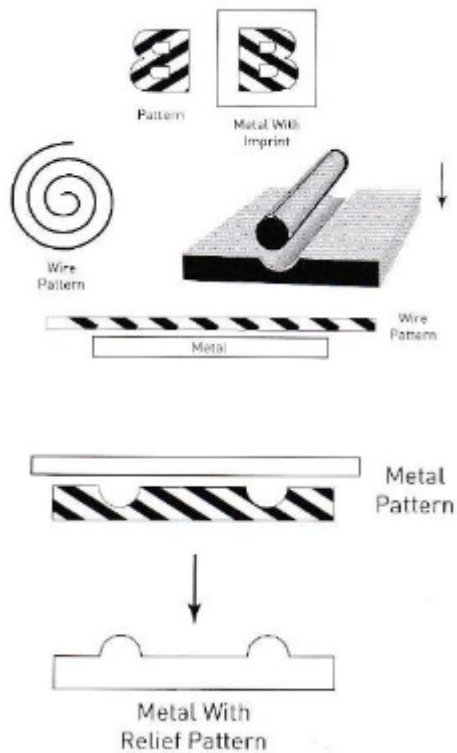

Troubleshooting

Problem	Cause	Solution
The edges of the metal are cracking.	When the metal was poured, the ingot is not uniform in shape or the metal was rolled too much without annealing	Remove the part of the metal with the crack (by sawing), anneal, and then hammer out the metal around the missing section until the edges are even. Anneal again and then re-re-roll.
The surface of the metal is flaking and/or cracking.	<ol style="list-style-type: none"> 1. When the metal was poured, the ingot mould was cold. 2. There may be too much old metal in the ingot. 3. The ingot was annealed too much. 4. There may be foreign metal in the ingot. 	Melt the ingot and reform in the ingot mould. Roll it out again. If the problem persists, it may be necessary to refine the metal before you use it again
When wire is rolled out, it is wavy or bent.	<ol style="list-style-type: none"> 1. There was not enough tension applied to the free end of the wire. 2. Too much pressure is being exerted by the rollers. 	<ol style="list-style-type: none"> 1. Hold the free end of the wire tight with one hand. 2. Remove sheet, anneal it, planish the distorted sections and re-roll. Apply less pressure to the rolls.

<p>When rolling sheet, it buckles.</p>	<p>Sheet was pushed through rollers after flipping end to end without annealing.</p>	<p>Remove sheet, anneal and re-roll.</p>
--	--	--